
Hygrometer user manual

Product diagram

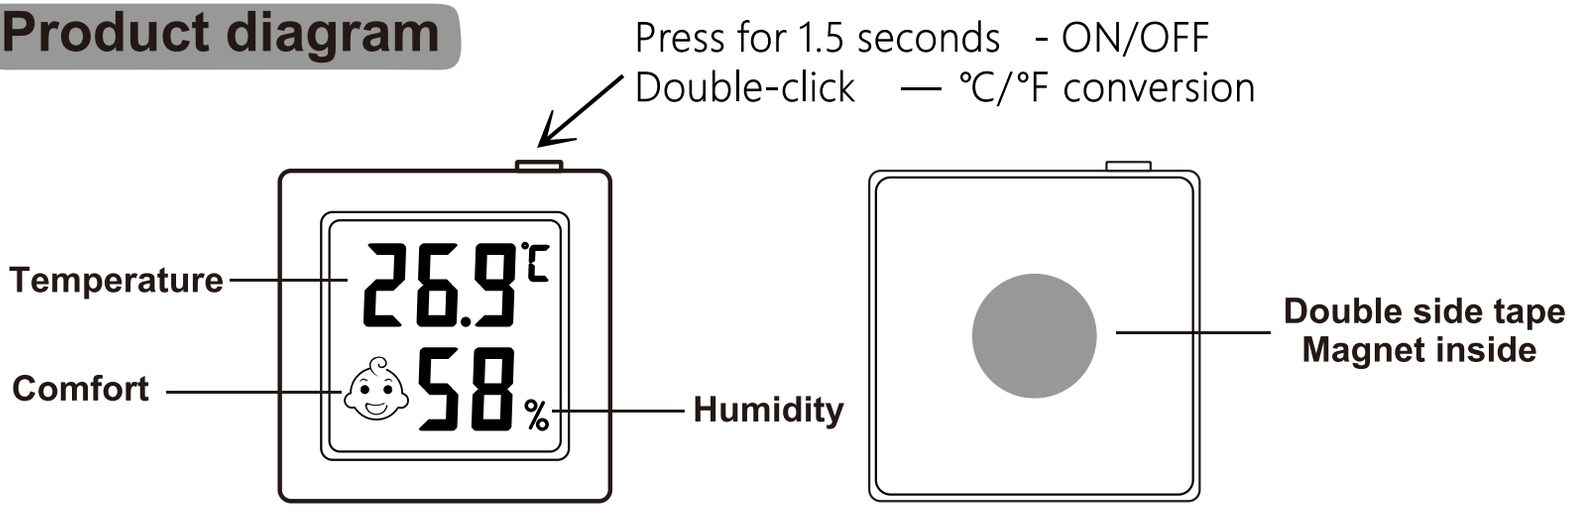

Product specifications

1.Temperature measurement range: -20℃ ~ 60℃(-4℉ ~ 140℉)
2.Temperature measurement accuracy: ± 1℃
3.Temperature resolution: 0.1
4.Humidity range: 20%-99%
5.Humidity measurement accuracy: ± 5%
6.Humidity resolution: 1%
7.Power supply: 3V CR2032*1

Product functions

1.Mounting mode:Double Side Tape / Powerful magnet
2.Temperature display / Humidity display
3.Comfort display



Comfortable **Normal comfortable** **Un-comfortable**