Thermo-hygrometer user manual KD-51

Product specifications

Temperature measurement range: -20℃ ～+60℃ (-4°F～+140°F)
Temperature measurement accuracy: ±1℃ (1.8°F)
Temperature resolution: 0.1
Humidity measurement range: 20%RH-99%RH
Humidity measurement accuracy: ±5%RH
Humidity resolution: 1%
Power supply: CR2032

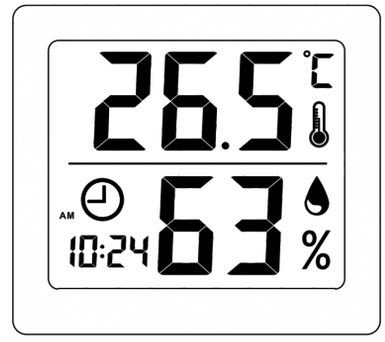

Basic functions

Time display
Temperature display / Humidity display
℃/°F temperature switch display

Operation method

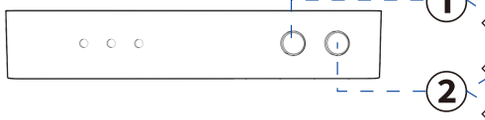

◇Hold (①)key for 1.5 seconds to power on/off
◇Click (①)key to the setting mode
◇Click (②)key to add the time
◇Click (②)key for 3 times to select the temperature unit:℃ or °F

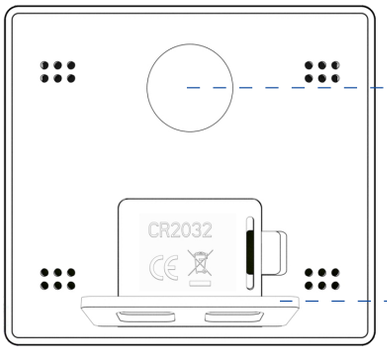

◇Stick the double-sided sticker on the back of the product and stick it on any surface.
◇Magnet inside to attach to any magnetic surface

◇Insert the bracket into the reserved hole, the product can stand on the table.

Time setting mode

●Click(①)key to time setting mode,Click(②)key to select 12/24HR
●Click(①)key to next step, Click(②)to add the time and hold the key to speed up setting
●After setting,Click(①)to confirm and quit
●The Sequence is “12/24HR” - “Time” - “Quit”
●In setting mode,without any operation about 5 seconds will return back to time mode automatically