Thermo-hygrometer user manual

KD-70

Product specifications

Temperature measurement range: -20℃～+60℃ (-4°F～+140°F)
Temperature measurement accuracy: ±1℃ (1.8°F)
Temperature resolution: 0.1
Humidity measurement range: 20%RH-99%RH
Humidity measurement accuracy: ±5%RH
Humidity resolution: 1%
Power supply: CR2032

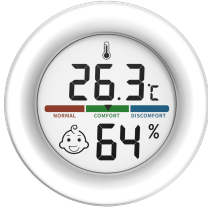

Basic functions

Temperature display / Humidity display
℃/°F temperature switch display
Comfort indicator

Operation method

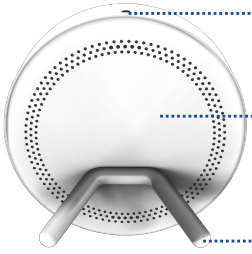

Hang hole for lanyard

Button inside the back cover,long press the button for 1.5 seconds to power on/ power off,Double click to select the temperature unit: ℃ / °F

The bracket is stored in the back shell,open the back cover, remove and attach to the hole,the hygrometer can stand on the table.

Comfort Indicator

Comfortable Normal Uncomfortable

Humidity / Temperature	< 40%	40%-74%	> 74%
<22℃			
22℃-28℃			
> 28℃			