Thermo-hygrometer user manual

Product specifications

Temperature measurement range: -20℃ ～+60℃ (-4°F～+140°F)
Temperature measurement accuracy: ±1℃ (1.8°F)
Temperature resolution: 0.1
Humidity measurement range: 20%RH-99%RH
Humidity measurement accuracy: ±5%RH
Humidity resolution: 1%
Power supply: 1.5V LR44 × 1

Basic functions

- Mounting mode : Double Side Tape / Desktop/Hanging
- Max/Min value display
- Temperature display
- Humidity display

Product diagram

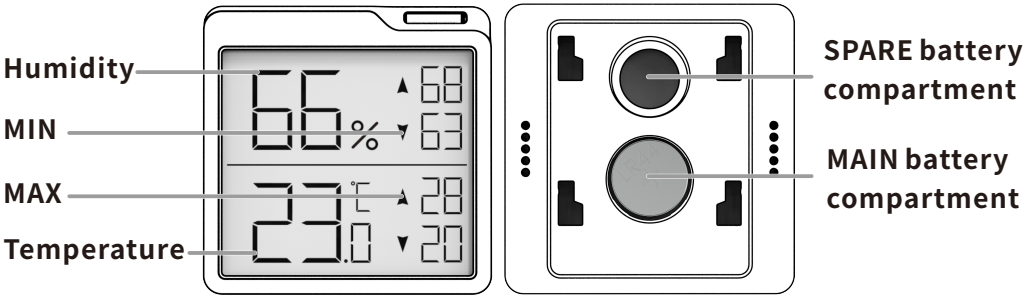

QUICK START: ① Open back cover → ② Move LR44 from SPARE to MAIN slot ("+" ↑) → ③ Close cover

YS-20