Hygrometer user manual

Product diagram

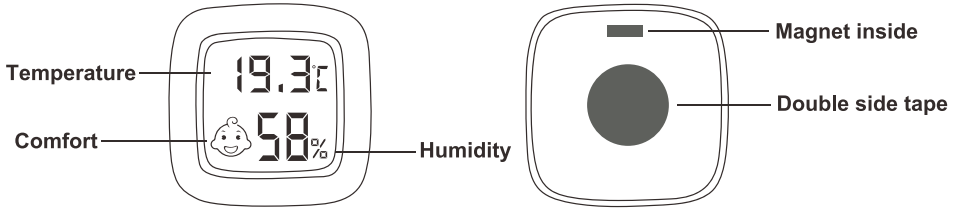

Product specifications

1.Temperature measurement range: -20℃ ~ 60℃(-4℉ ~ 140℉)
2.Temperature measurement accuracy: ± 1℃
3.Temperature resolution: 0.1
4.Humidity range: 20%-99%
5.Humidity measurement accuracy: ± 5%
6.Humidity resolution: 1%
7.Power supply: 3V CR2032*1

Product functions

1.Mounting mode:Double Side Tape / Powerfull magnets
2.Temperature display
3.Humidity display
4.Comfort level display

Comfort Level

Temperature \ Humidity	< 40%	40%-74%	> 74%
< 22℃			
22℃-28℃			
> 28℃			